Mixcheck Basic fault finding

Power Verify power supply rails are +/- 5VDC +/- 0.2 (JP1-JP2) & (TP1 & TP2)

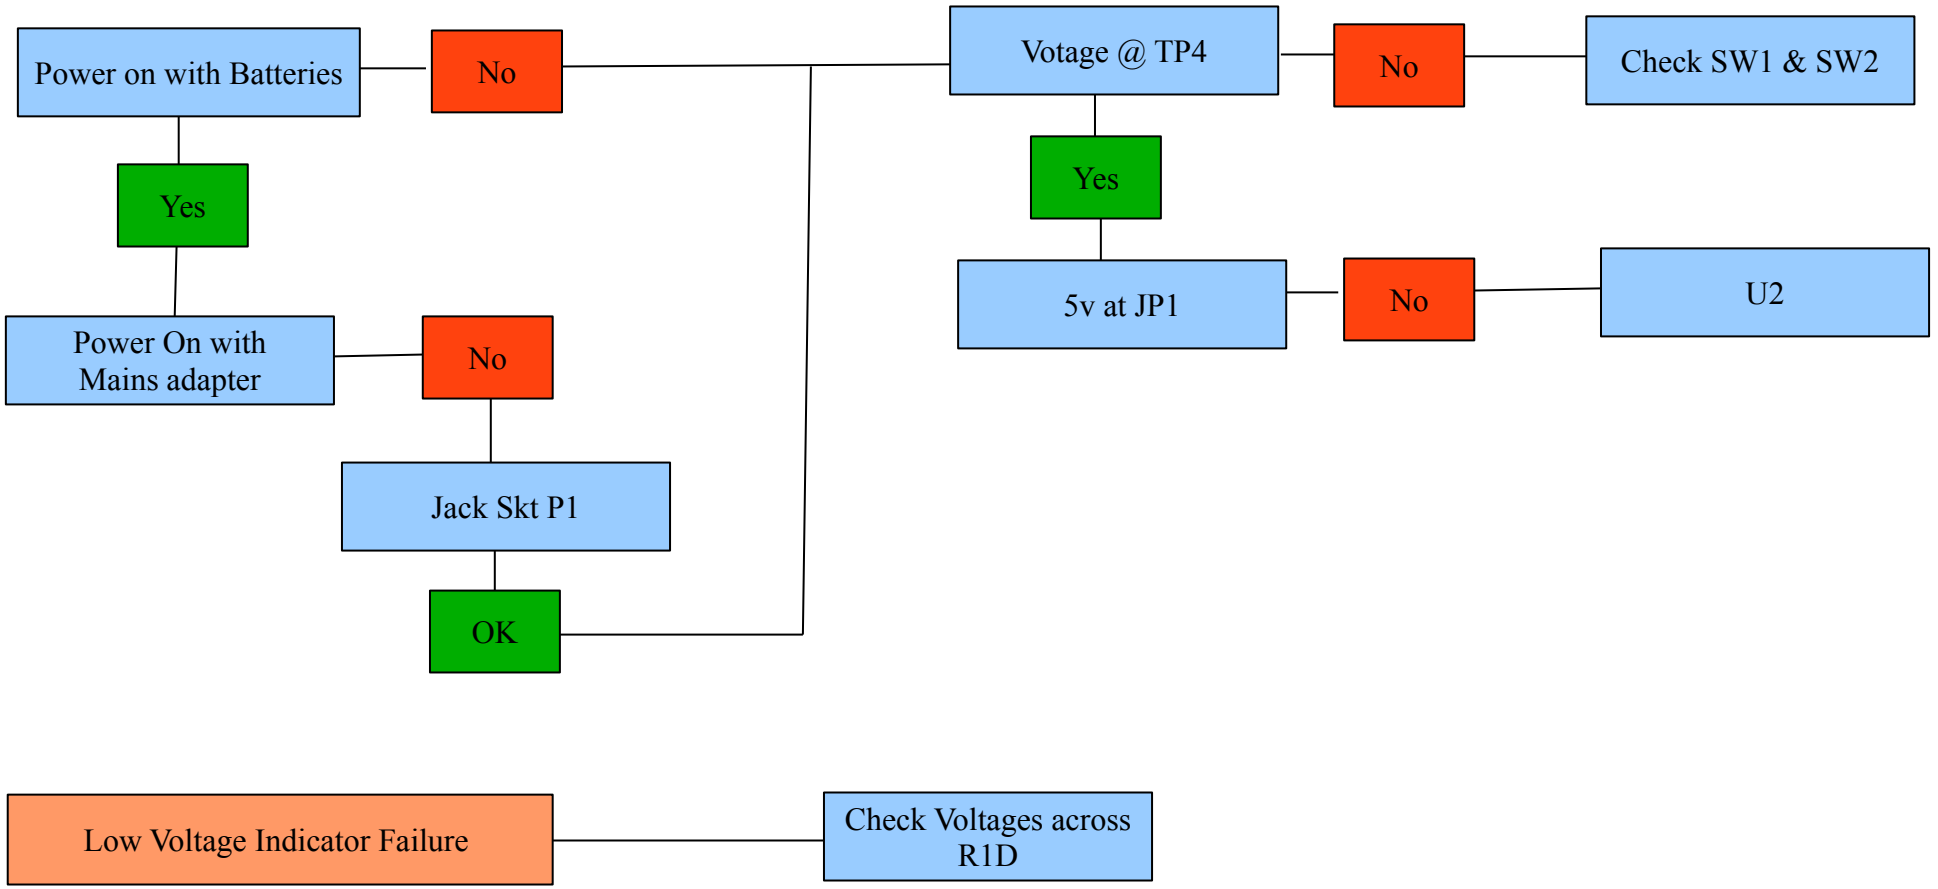

Mixcheck Basic fault finding

O2 Display

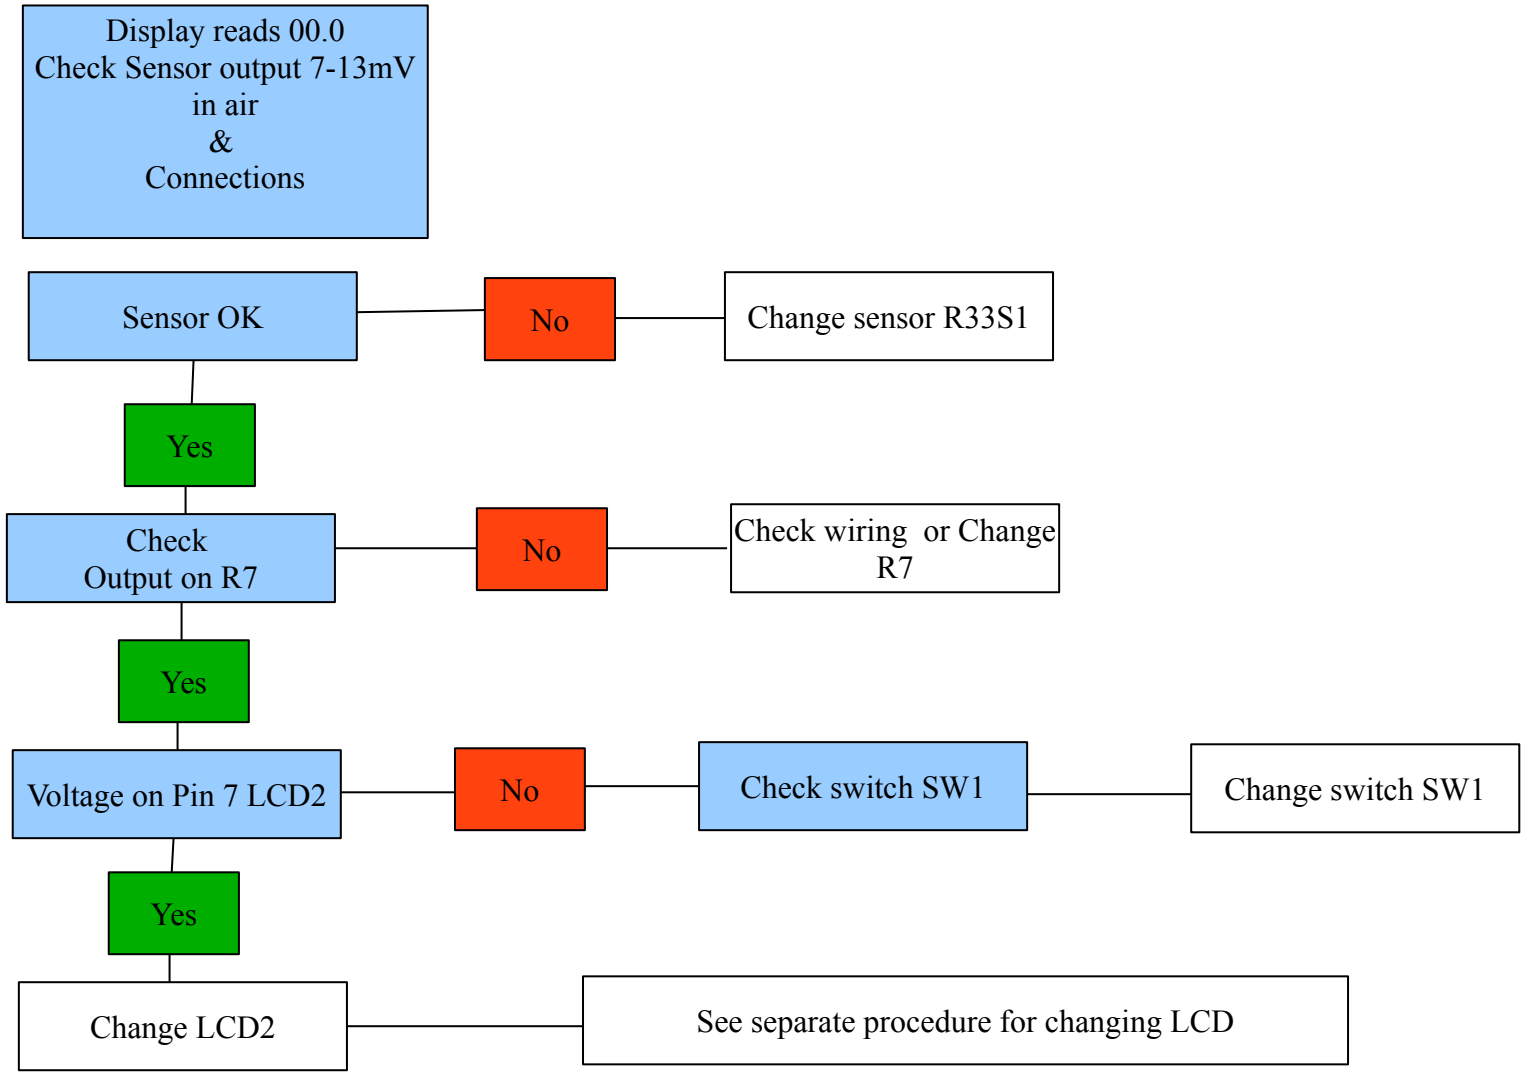

Mixcheck Basic fault finding

Helium reads 00.0

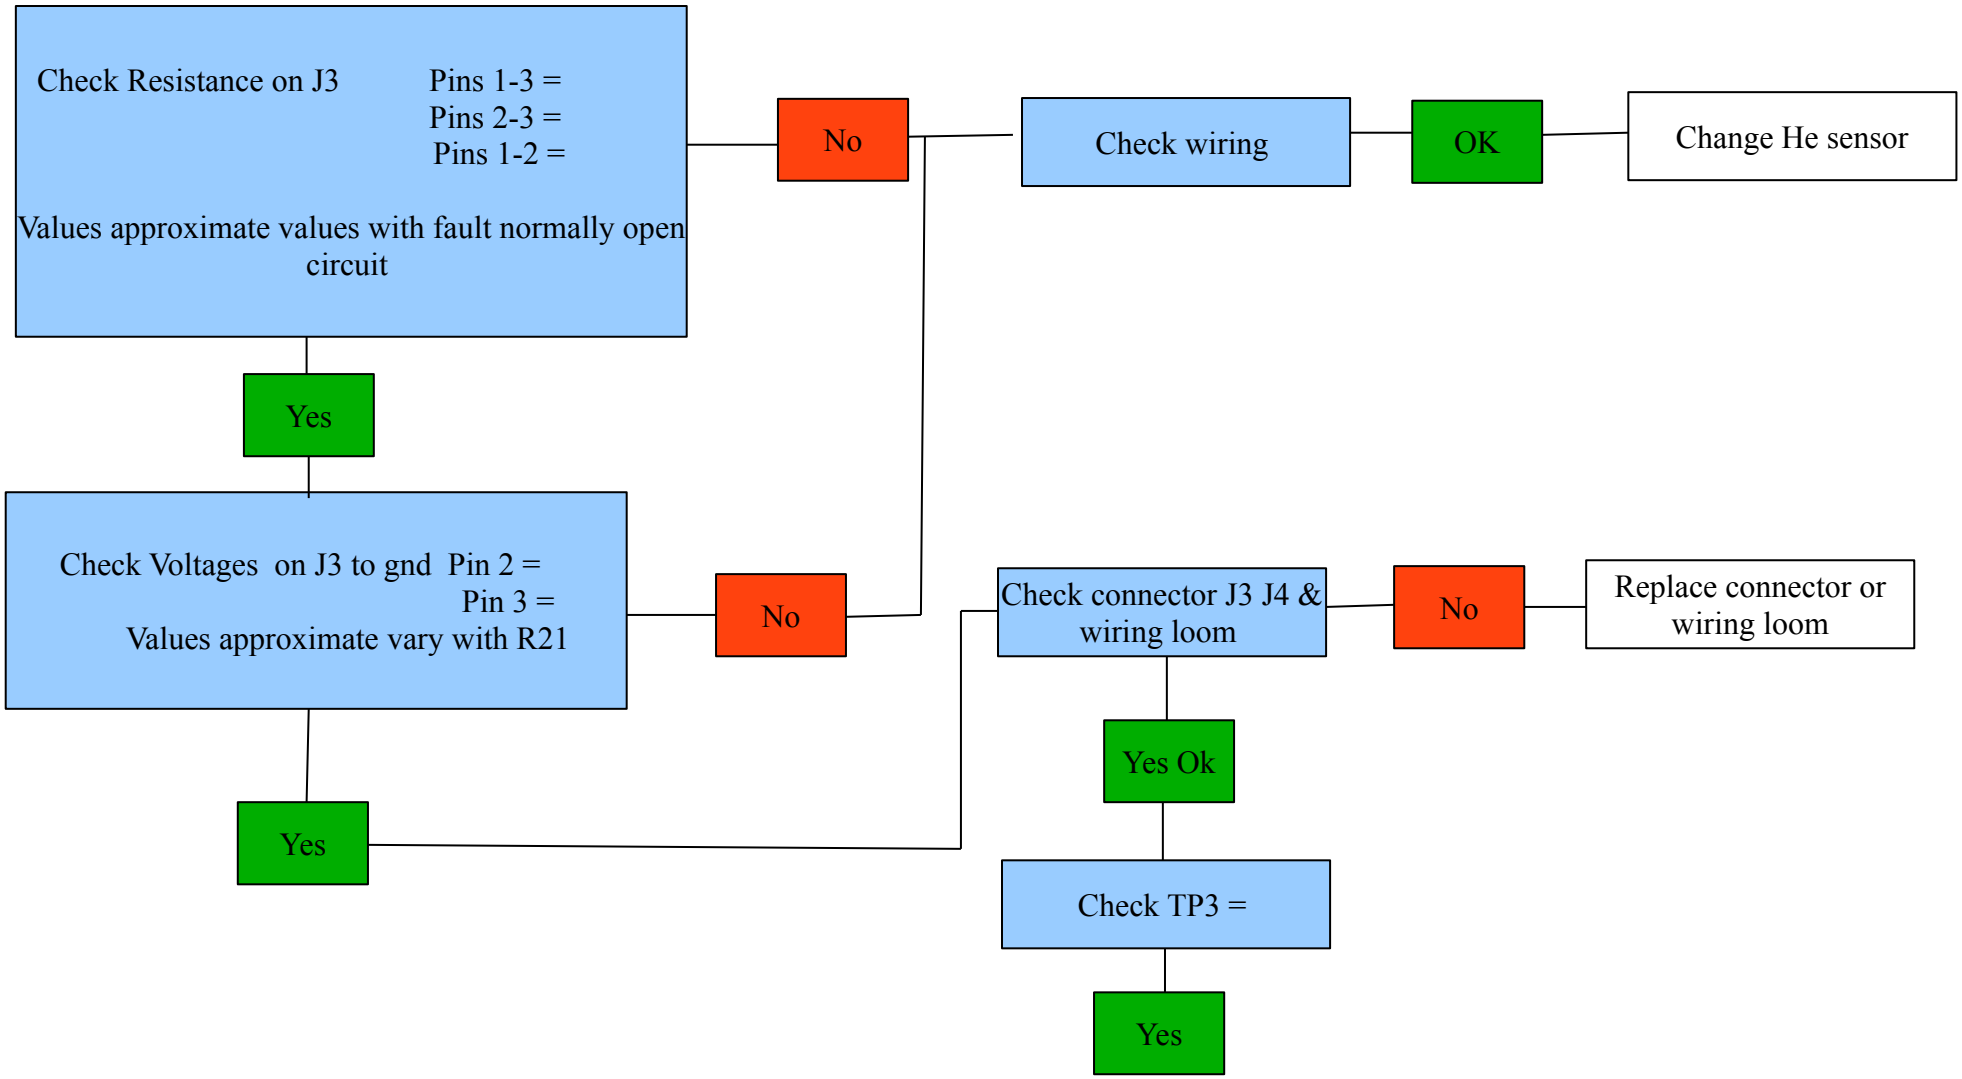

Mixcheck Basic fault finding

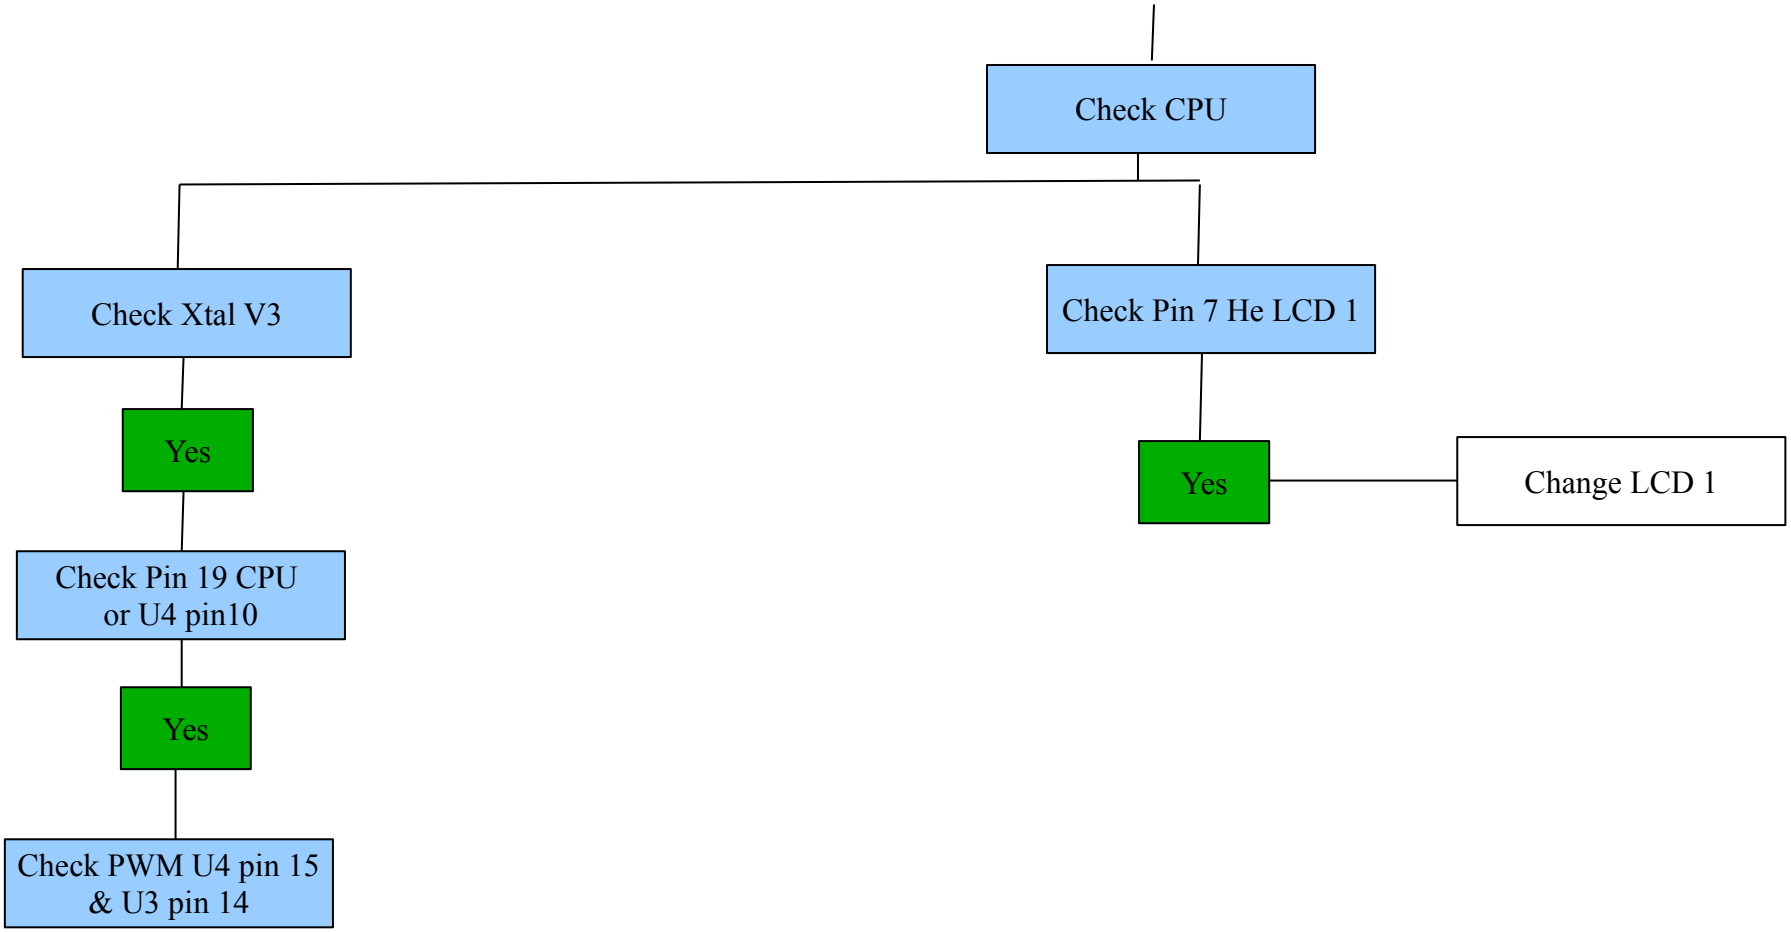

Use Calibration procedure Check He 0% 100% and Trimix approx 17% he 22% oxygen . If incorrect change Software.