

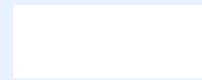
Safety Inspection and reporting carried out in accordance with the Gas Safety (Installation and Use) Regulations 1998 section 26(9) and the Gas Industry Unsafe Situations Procedure.

Company / Installer	Job Address	Customer / Landlord
Engineer: Jules Hawley	Name: _____	Name: _____
Company: Airedale Gas Services	Address: 13	Company: Wilman & Lodge
Address: Morningside	Station Road	Address: 77
St Marys Road	Cross Hills	Main street
Keighley	West Yorkshire	Cross hills
West Yorkshire	Post Code: BD20 7EH	North Yorkshire
Post Code: BD20 5PA	Tel. No: _____	Post Code: _____
Tel No: 07930164130		Tel. No: _____
Gas Safe Reg: 536552		
ID Card No: 4684869		

Appliance Details	Inspection Details																				
	Location	Appliance Type	Make	Model	Flue Type	Landlord's Appliance	Appliance Inspected	Operating Pressure (mbar)	Heat Input (kW/h)	High Combustion Reading			Low Combustion Reading			Safety device(s) correct operation	Ventilation Provision satisfactory	Visual condition of flue and termination satisfactory	Flue Performance test	Appliance Serviced	Appliance safe to use
										Ratio	CO ppm	CO2 %	Ratio	CO ppm	CO2 %						
1	Lounge	Fire	Valor	622	OF	Yes	Visual	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	NA	No
2	Kitchen	Hob	Diplomat	Built-in	FL	Yes	Yes	NA	7.15	NA	NA	NA	NA	NA	Yes	Yes	NA	NA	No	Yes	
3	COMPARTMENT	Combination Boiler	Ideal	Instinct 2 24	RS	Yes	Yes	NA	22.66	0.0011	99	9.0	0.0005	42	8.4	Yes	Yes	Yes	Pass	No	Yes
4																					
5																					
6																					

Defects / Identified	Labels and Warning Notice Issued	CO Alarm(s)	Optional Checks
1	Fire in poor condition, advise full strip service	CO Alarm(s) fitted	Smoke Alarm(s) fitted
2			
3		CO Alarm(s) tested and Satisfactory	Smoke Alarm(s) tested and Satisfactory
4			
5			
6			Water quality/level of inhibitor acceptable

Emergency Control Accessible <input checked="" type="checkbox"/> Yes Gas Tightness Satisfactory <input checked="" type="checkbox"/> Yes Gas Installation Pipework Visual Inspection Satisfactory <input checked="" type="checkbox"/> Yes Equipotential Bonding <input checked="" type="checkbox"/> Yes NEXT INSPECTION DUE BEFORE 17-Feb-2027	Comments Clean air 20.9% Co alarm tested no date of install Smoke alarms tested bottom of stairs dead top of stairs working no dates
--	--

Signatures Issued by: Signed  Print Name: Jules Hawley	Received Signed by:  Print Name: 	Date: 16-Feb-2026
--	---	---